



G360 SUPER FAST SYSTEM.

NOTE: Correct machine speed, minimal product and applying no pressure are the keys to achieving optimum results.
Clean the G Mop Super High Cut Pad regularly with a G Plus Spurring Brush **1090005**

IDENTIFY DEFECT

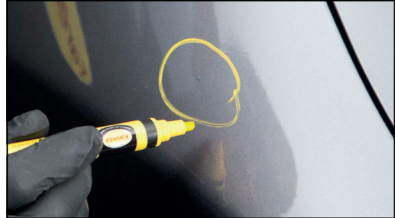

Mark defect with a G Plus Autopen **AP-5YW** (yellow)



REMOVE DEFECT



P1500

~~**P3000**~~
NOT REQUIRED

Step 1: HIGH CUT

Remove P1500 sanding marks



G360 Super Fast Compound.
SFC101 (1kg)



G Mop Super High Cut Pad.
GMC650 (6" / 150mm)

- Eliminates P1500 sanding marks
- Removes the need for P3000
- Prepares for second stage polishing



Only a small amount needed



Cut 1500 rpm
- light pressure
End 900 rpm
- no pressure



Step 2: MEDIUM CUT

Remove process marks - swirls and holograms



G360 Super Fast Compound.
SFC101 (1kg)



G Mop Flexible Yellow Compounding Foam.
GMC624 (6" / 150mm)

- Eliminates holograms
- Removes swirl marks
- Gives an excellent gloss finish



Only a small amount needed



900 - 1300 rpm



Wipe clean
FC-3

Optional Step 3: FINE CUT

Enhance depth of gloss



G360 Super Fast Finish.
SFF101 (1 ltr)



G Mop Flexible Black Finishing Foam.
GMF624 (6" / 150mm)

- Ideal for darker colours after using G360 Super Fast Compound
- Eliminates minor swirl marks
- Leaves an enhanced deep gloss finish



Only a small amount needed



800 - 1100 rpm



Wipe clean
FC-3



For best results and longer pad life always use a G Mop Flexible Back Plate, **GMB146** (14mm thread), **GMB586** (5/8" thread) or **GMB166** (16mm thread).



#FARECLAG360

+44 (0) 1920 465 041 | enquiries@farecla.com | www.farecla.com

Farécla SURFACE FINISHING SPECIALISTS